

Work Order ID 129169

Friday, January 30, 2015 8:51:38 AM

129169

Ship Feb 13

Page 1

Item ID: D3121-143

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Bracket Assembly

Start Date: 1/30/2015 Start Qty: 2.00

2

Cust Item ID:

Required Date: 1/30/2015 Req'd Qty: 2.00

2

Customer:

Reference:

Approvals: Process Plan: MLS

Date: 1/30/2015 Tooling:

Date:

Run Start

NR1

QC:

Date: SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3121	Rev E								
100	BAND SAW	0.00							
100									
Bandsaw	Memo	113.4							
Jeaspa Bandsaw	Cut blanks: (1.250" x 2.000") 4.425" long								
110	HAAS CNC VERTICAL MACHINING #1	0.00							
110									
HAAS 1	Memo	0.00							
HAAS CNC vertical machine #1	1-Machine D3121-113 as per Folio FA330 and Dwg D3121 Identify as D3121-113 2-Deburr 3-Scribe batch number								
120	QC2- Inspect parts off machine FAI/FAIB	0.00							
120									
QC	Memo	0.00							
Quality Control									

150205 2 0

2 0 JFC 2015-02-13

2 0 JFC 2015-02-13

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube ☐</td> <td style="width: 25%;">Crosstube ☐</td> <td style="width: 25%;">Water Jet ☐</td> <td style="width: 25%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 129169

Friday, January 30, 2015 8:51:38 AM

129169

Page 2

Item ID: D3121-143
Revision ID:
Item Name: Bracket Assembly

Accept

N900040100

Setup Start ***NS1***
Stop ***NS2***

Start Date: 1/30/2015 Start Qty: 2.00 ***2***
Required Date: 1/30/2015 Req'd Qty: 2.00 ***2***

Cust Item ID:
Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:
QC: Date: SPC (Y/N): Date:

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	QC8- Inspect parts - second check	0.00							DAS 44 15/02/14 9-89
130						2	Ø		
QC	Memo	0.00							
Quality Control									
140		0.00							
140	Small Fab								
Small Fab	Memo	0.00							
Small Fab	Assemble D3121-143 as per Dwg D3121.								
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									

DAS
38
9-89
FEB 17 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 129169

Friday, January 30, 2015 8:51:38 AM

129169

Page 3

Item ID: D3121-143

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Bracket Assembly

Start Date: 1/30/2015 Start Qty: 2.00

2

Cust Item ID:

Required Date: 1/30/2015 Req'd Qty: 2.00

2

Customer:

Reference:

Run Start ***NR1***

Approvals: Process Plan: Date: Tooling: Date:

Stop ***NR2***

QC: Date: SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	Identify as per dwg & Stock Location: Stop	0.00							
160									
Packaging	Memo	0.00				2		FEB 18 2015	DAS 06 9-69
Packaging									
170	QC21- Final Inspection - Work Order Release	0.00							
170									
QC	Memo	0.00							
Quality Control									

15/2/18 *[Signature]*

[Signature] 2-18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Friday, January 30, 2015 8:51:43 AM

Page 1

Work Order ID: 129169

129169

Parent Item: D3121-143

D3121-143

Parent Item Name: Bracket Assembly

Start Date: 1/30/2015

Required Date: 1/30/2015

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP Rev:Pick:A04.02.18New issueKJ/DS
IPP Rev:B ECN 1060 07-11-12 DD verified by:EC
IPP Rev:C New Dimensions for Blank Size 08-07-23 JLM Verified By:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

M174B1.250X02.000 Purchased No

M174B1 250X02 000

17-4 SS Bar 1.250 x 2.00

Location	Loc Qty	Loc Code
MAT010	2.4	
M126132	0.6	
M129418	0.9	
M129636	0.9	

**

M131457

08

15-02-05

D3121-21 Manufactured No

D3121-21

Bolt

Location	Loc Qty	Loc Code
ST018	44	
125747	3	
127347	41	

**

2

4

15/02/17

DAS
36
9-89

D3121-241 Manufactured No

D3121-241

Bearing Assembly

Location	Loc Qty	Loc Code
FG	14	
89826	4	
95927	10	
ST019	7	
129080	7	

**

2

4

15/02/17

DAS
36
9-89

B128510

(40)

M1021457

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD		Work Order:	129169
Description: Bracket		Part Number:	D3121-113
Inspection Dwg: D3121	Rev: E	Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
0.080	+/-0.010	0.0805	✓		Caliper	JFC-01
0.300	+/-0.010	0.302	✓		"	"
R0.375	+/-0.010	0.375	✓		rad b	Shop
1.54	+/-0.030	1.545	✓		caliper	JFC-01
0.350	+/-0.010	0.353	✓		"	"
R0.25	+/-0.030	0.250	✓		rad b	Shop
Ø0.392	+0.002/-0.000	0.393	✓		mic 0-1	JFC-02
Ø0.201	+/-0.010	0.201	✓		caliper	JFC-01
2.540	+/-0.010	2.539	✓		caliper	JFC-01
1.590	+/-0.010	1.590	✓		"	"
0.160	+/-0.010	0.159	✓		"	"
0.400	+/-0.010	0.398	✓		"	"
1.220	+/-0.010	1.222	✓		Hb	31006
1.600	+/-0.010	1.603	✓		caliper	JFC-01
3.80	+/-0.030	3.800	✓		"	"
1.800	+/-0.010	1.803	✓		"	"
R0.50	+/-0.030	0.500	✓		rad b	Shop
0.130	+/-0.010	0.131	✓		mic 0-1	JFC-02
3.41	+/-0.030	3.39	✓		caliper	JFC-01
3.65	+/-0.030	3.654	✓		Hb	31006
2.24	+/-0.030	2.230	✓		Caliper	JFC-01
45°	+/-0.1°	45°	✓		Ang b	Shop
R0.25	+/-0.030	0.250	✓		rad b	Shop
3.97	+/-0.030	3.977	✓		caliper	JFC-01
R0.38	+/-0.030	0.375	✓		rad b	Shop
Ø0.392	+0.002/-0.000	0.393	✓		mic 0-1	JFC-02
Ø0.201	+/-0.010	0.201	✓		caliper	JFC-01
0.268	+/-0.010	0.268	✓		"	"
R0.260	+/-0.010	0.260	✓		rad b	Shop
0.080	+/-0.010	0.080	✓		caliper	JFC-01
0.300	+/-0.010	0.300	✓		"	"
0.381	+/-0.010	0.378	✓		"	"
0.201	+/-0.010	0.201	✓		"	"
0.580	+/-0.010	0.578	✓		"	"
0.400	+/-0.010	0.398	✓		"	"

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube ☐</td> <td style="width: 25%;">Crosstube ☐</td> <td style="width: 25%;">Water Jet ☐</td> <td style="width: 25%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--




DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 1 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2
A	02.04.15	NEW ISSUE	
B	03.01.16	ADD RIDGES; ADD MAT'L PROP; FIX P/N ADD -141/-143/-144/-145/-146	
C	04.02.17	ADD CLEARANCE; USE -241 BEARING	
D	06.05.17	D3121-25 CAP WAS 1.024, NOW 1.000	
E	07.11.07	ADD TOLERANCE TO 0.032 (DETAIL B)	


RELEASED
07.11.07

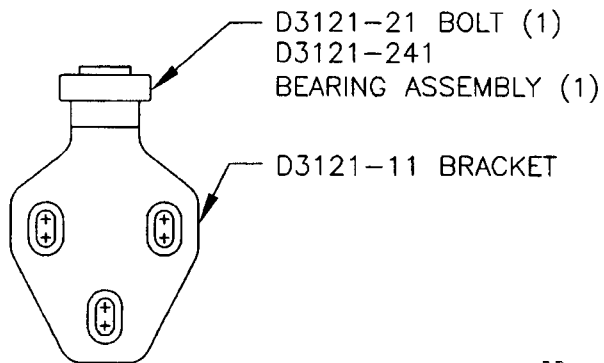

D3121-041 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-33)

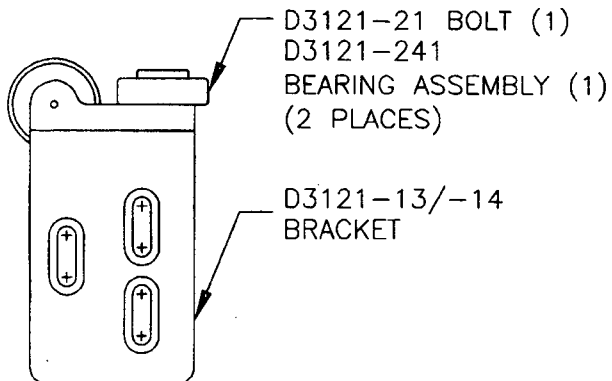

**D3121-043 (SHOWN) / D3121-044 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-37/-38)

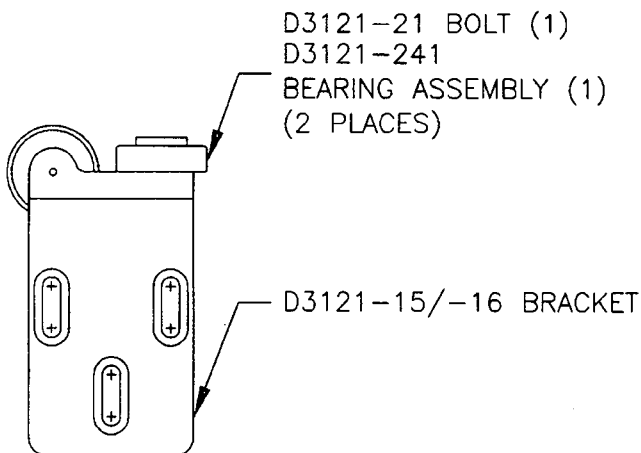

**D3121-045 (SHOWN) / D3121-046 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-35/-36)

129166-105
1501-36

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 2 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

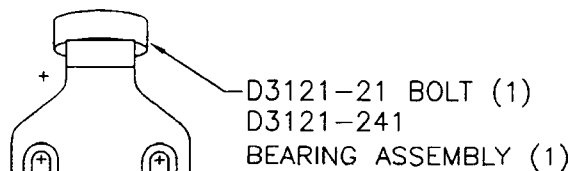


D3121-141 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23001-01)

RELEASED
07.11.07 W

D3121-111 BRACKET

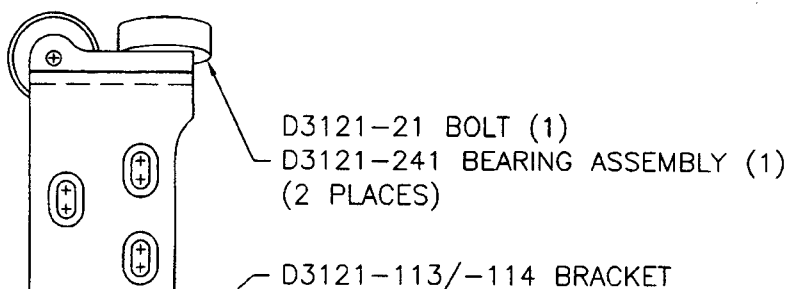

D3121-143 (SHOWN) / D3121-144 (OPPOSITE) BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-03/-04)

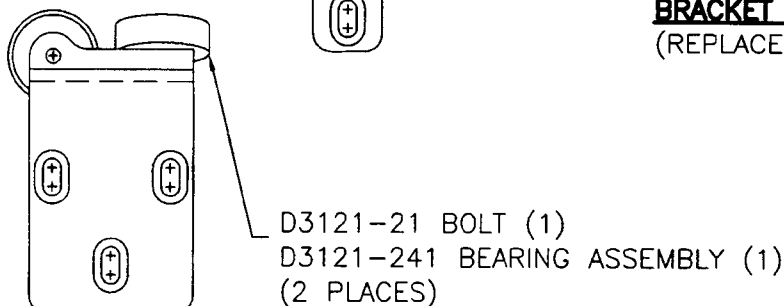

D3121-145 (SHOWN) / D3121-146 (OPPOSITE) BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-05/-06)

D3121-115/-116 BRACKET

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									



FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 3 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1


DETAIL A:
SLOT DETAIL
SCALE 2:1
VIEW ROTATED

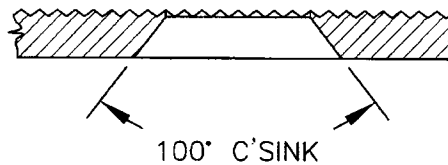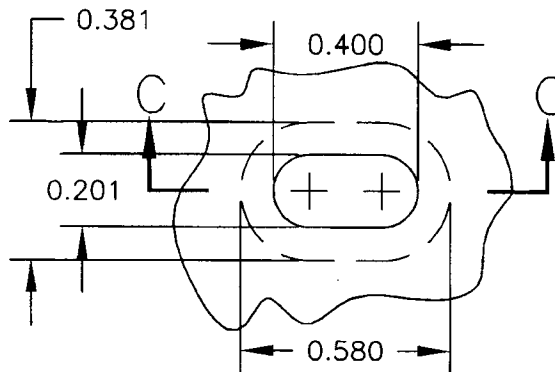

SECTION
C-C

RELEASED
07.11.07

DETAIL B:
RIDGE DETAIL
PARTIAL SECTION
SCALE 1:20

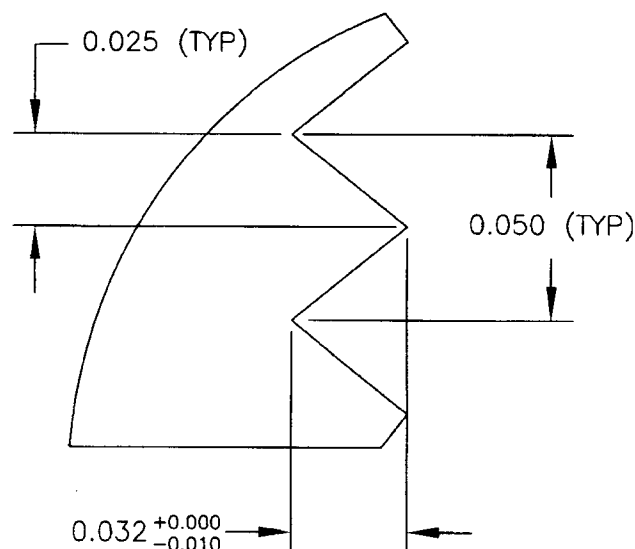

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 4 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1

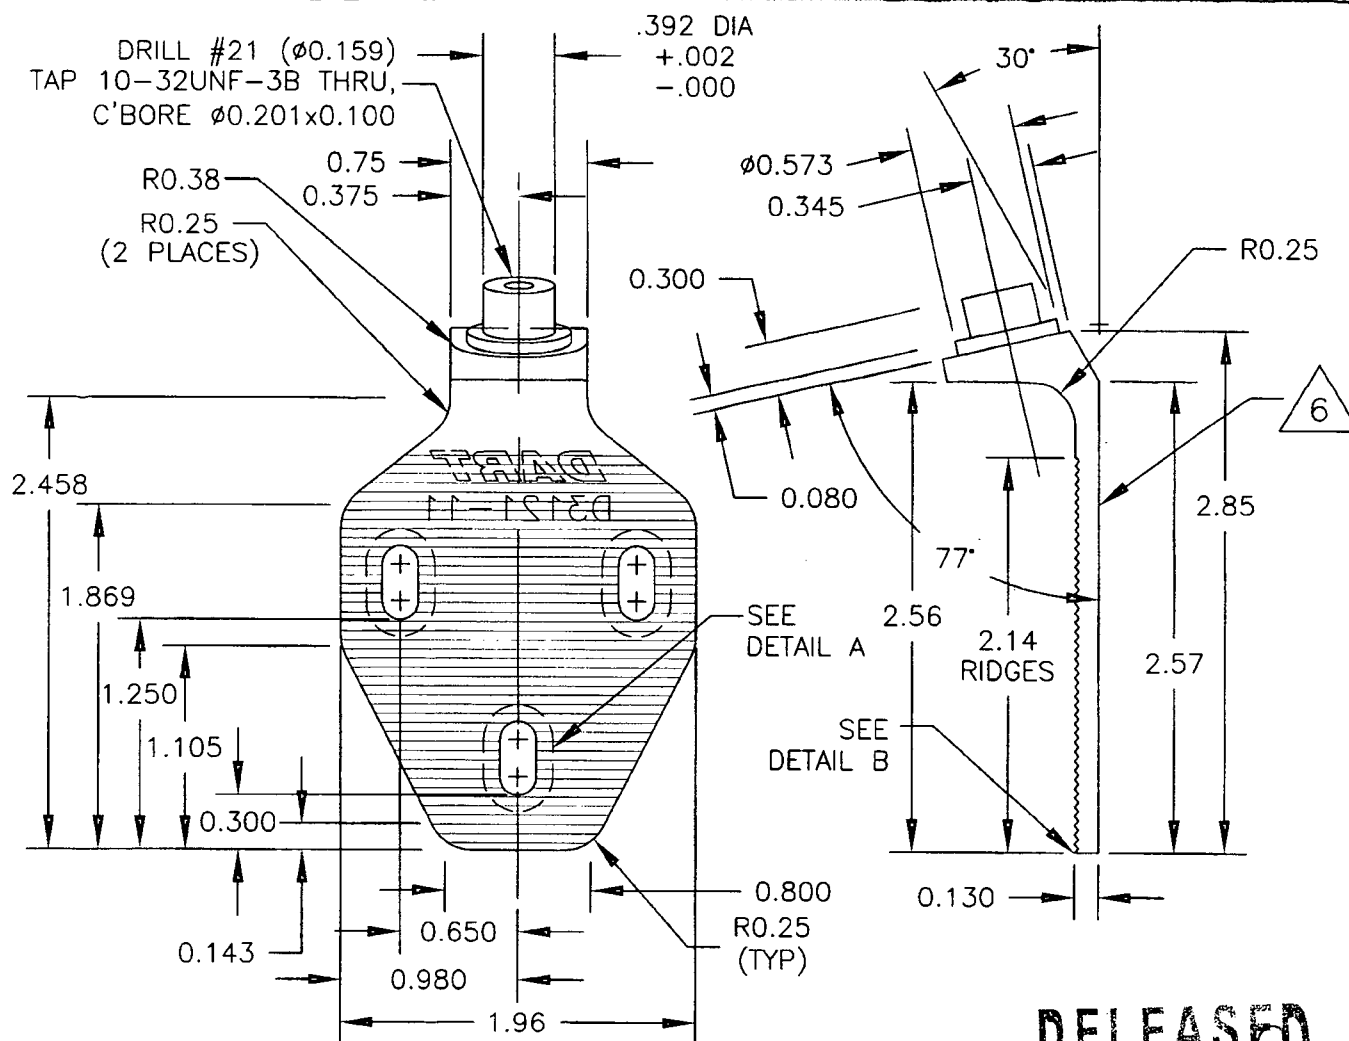

RELEASED
07.11.07

D3121-11 BRACKET

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2004 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 5 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

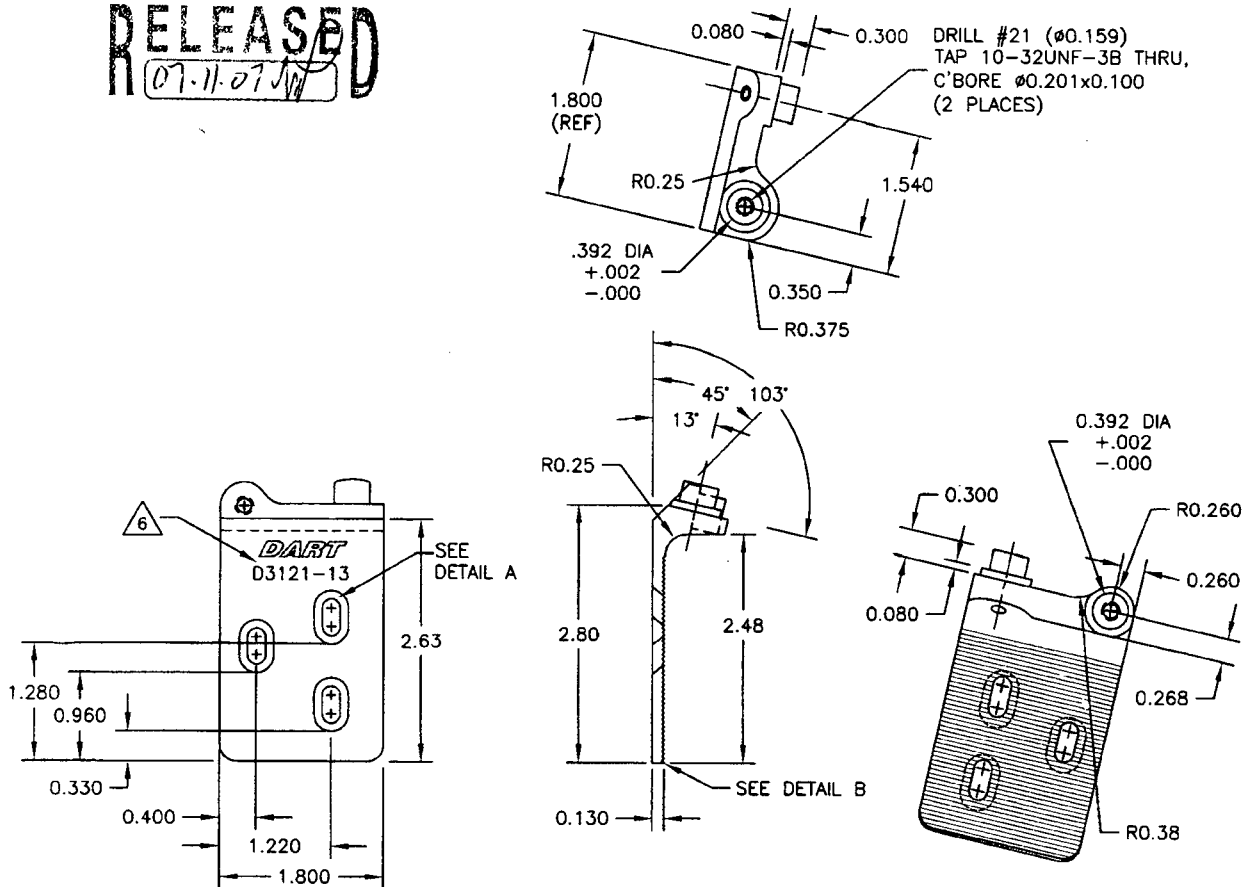

D3121-13 BRACKET (SHOWN)

D3121-14 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---



DESIGN #1	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #1	APPROVED #1	DRAWING NO. D3121	REV. E SHEET 6 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

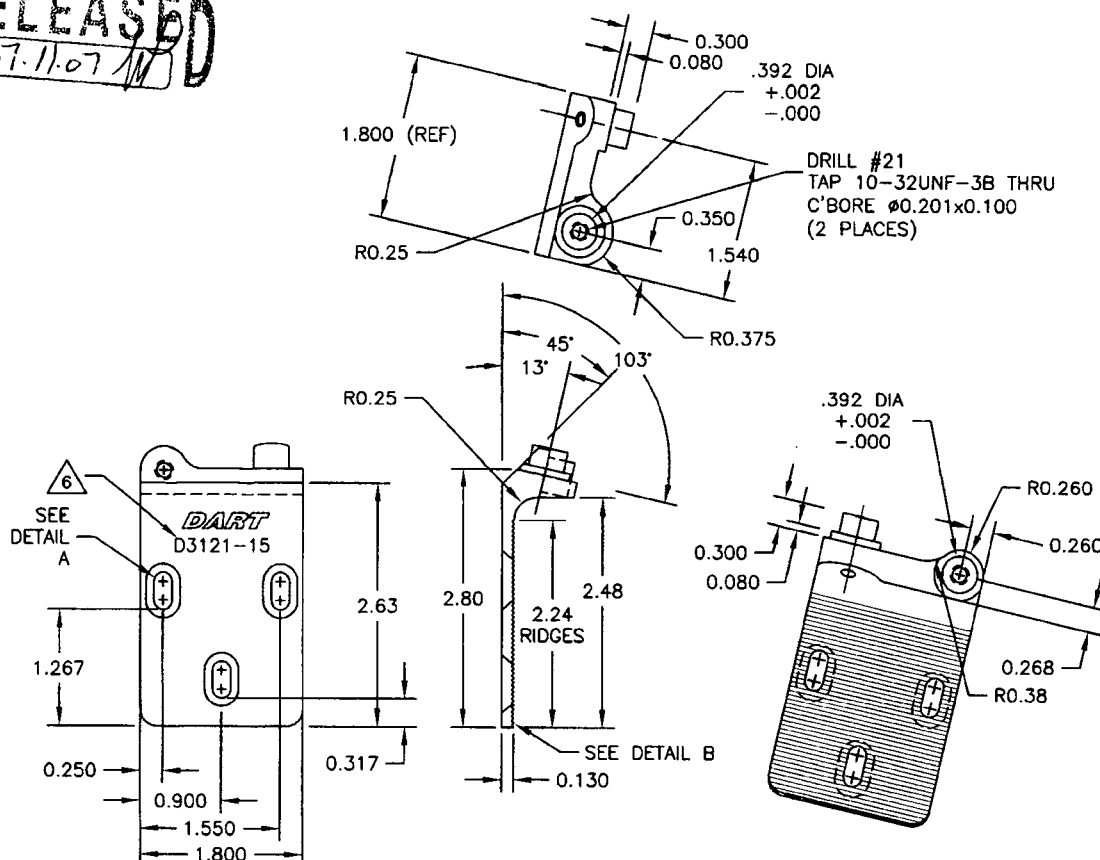

D3121-15 BRACKET (SHOWN)

D3121-16 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N AND LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 7 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07/W

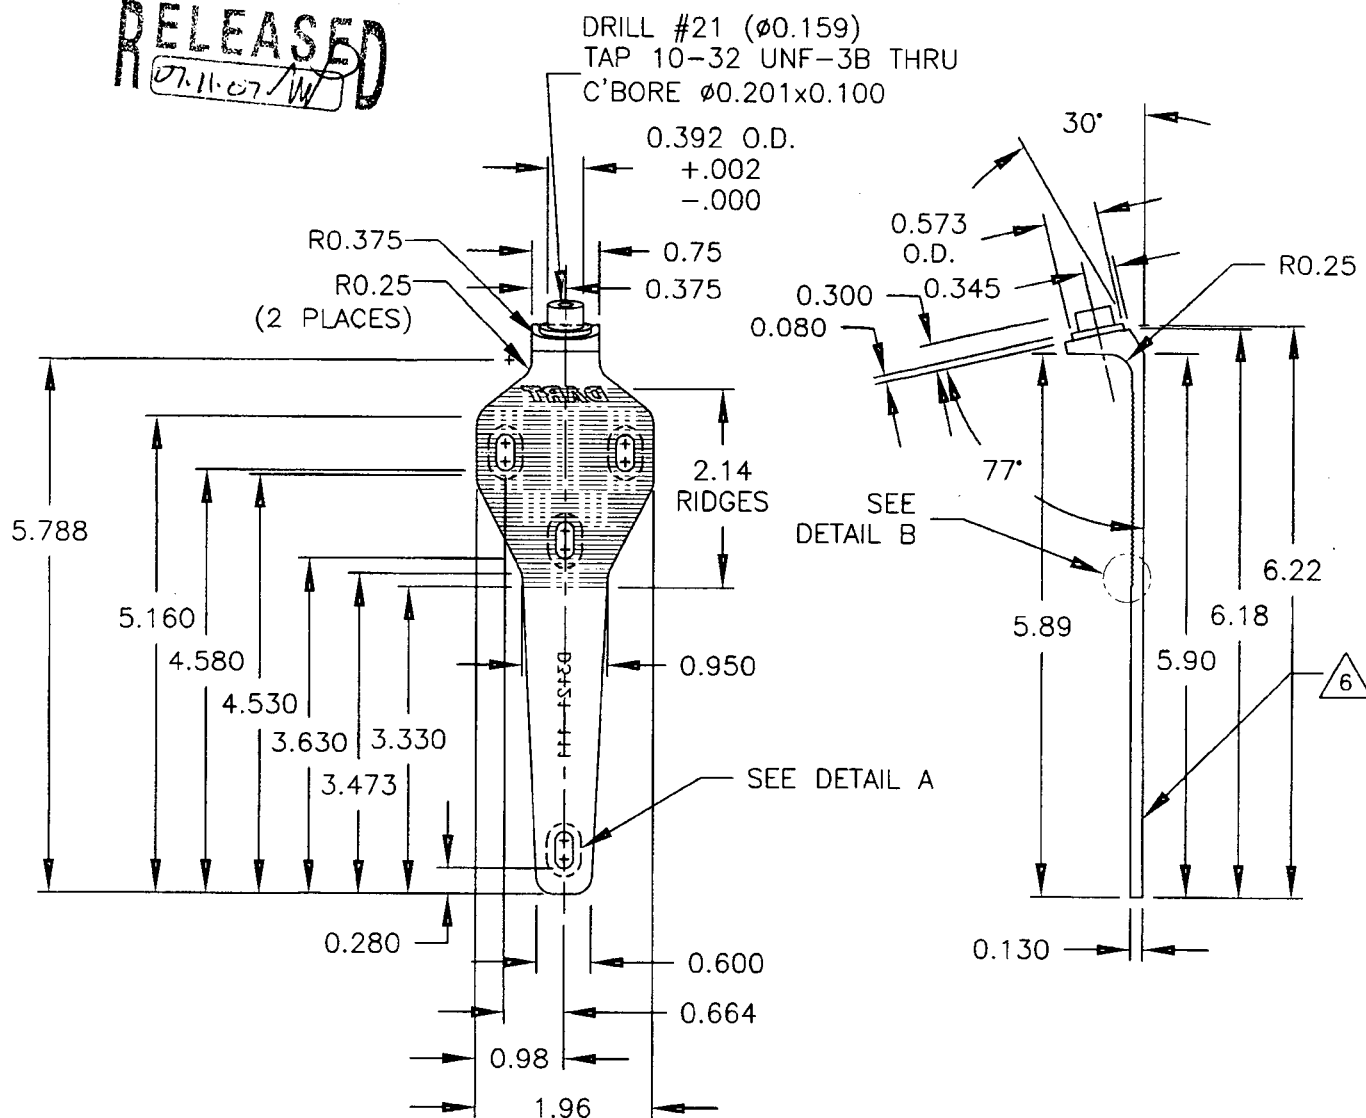

D3121-111 BRACKET

- 1) REPLACES PREMIER P/N B32-23001-11
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 8 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

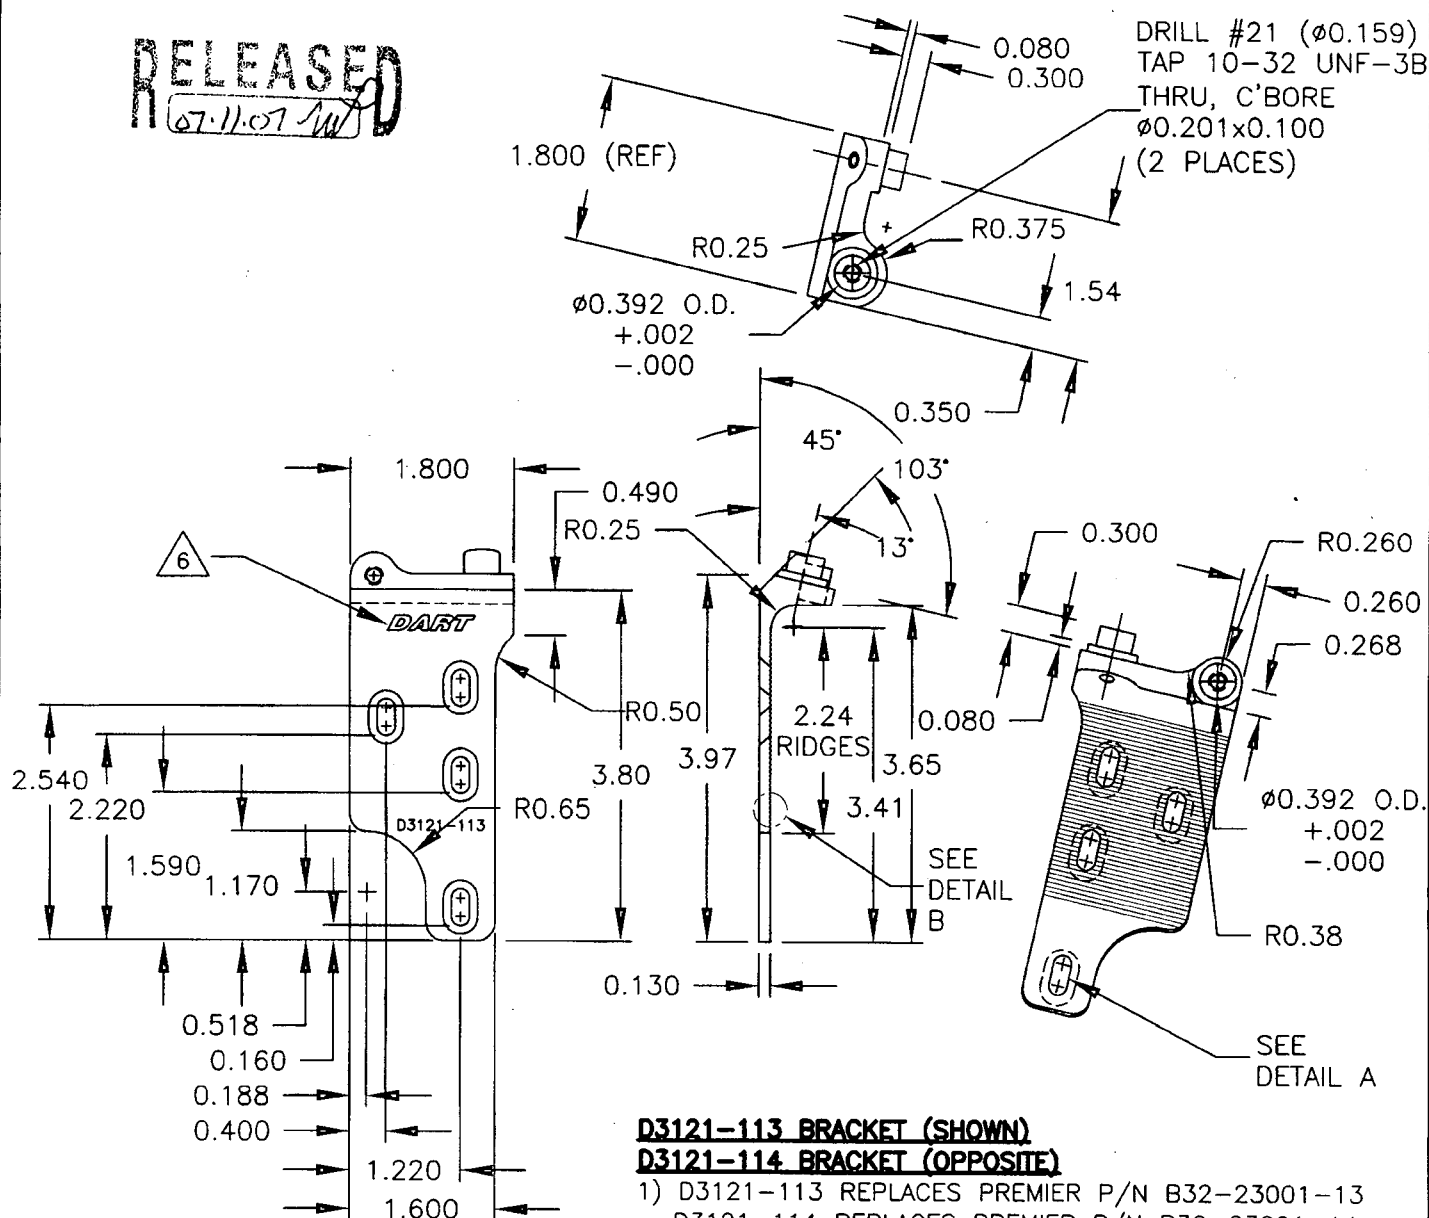

D3121-113 BRACKET (SHOWN)

D3121-114 BRACKET (OPPOSITE)

- 1) D3121-113 REPLACES PREMIER P/N B32-23001-13
D3121-114 REPLACES PREMIER P/N B32-23001-14
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--



DESIGN #1	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #1	APPROVED #1	DRAWING NO. D3121	REV. E SHEET 9 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

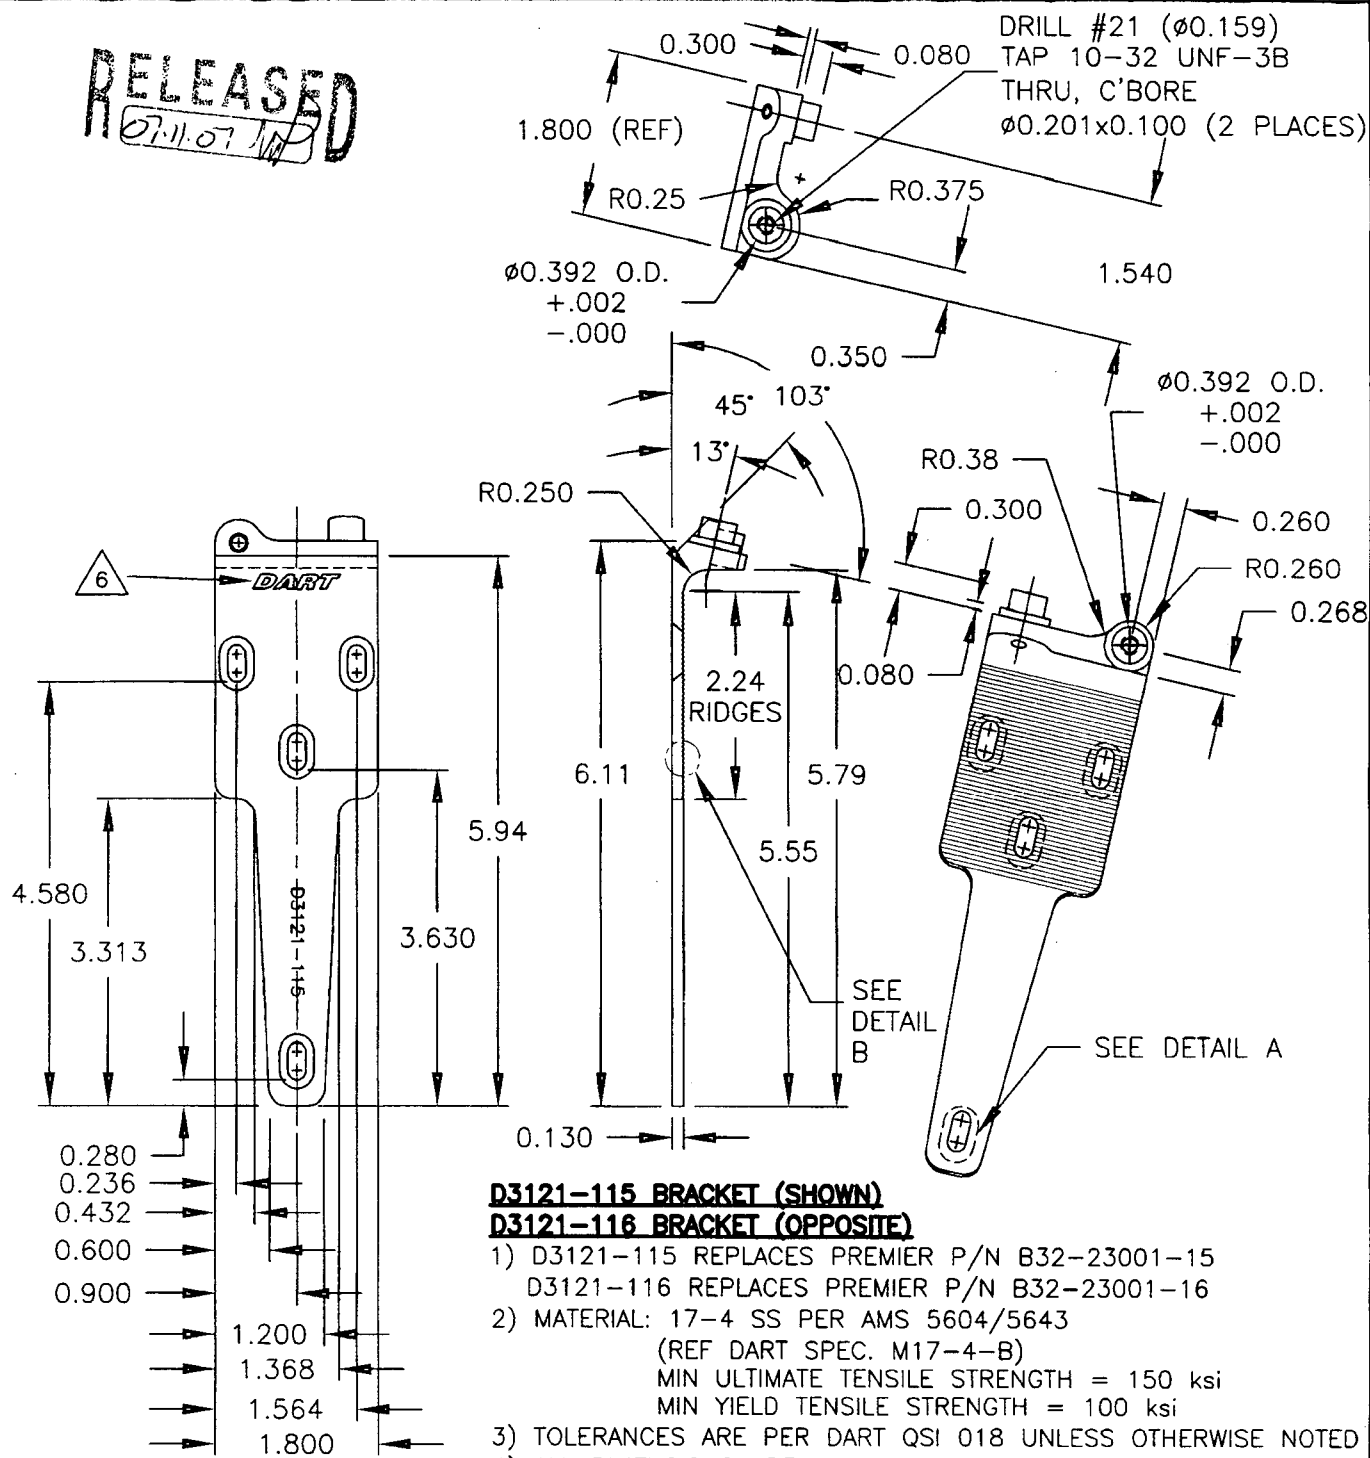

D3121-115 BRACKET (SHOWN)
D3121-116 BRACKET (OPPOSITE)

- 1) D3121-115 REPLACES PREMIER P/N B32-23001-15
D3121-116 REPLACES PREMIER P/N B32-23001-16
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--




DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 10 OF 10
DATE 07.11.07	TITLE BRACKET ASSEMBLY		SCALE 1:1

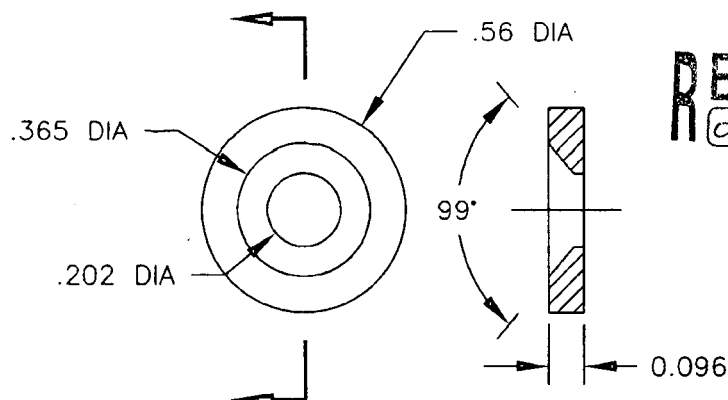


D3121-17 WASHER (SCALE 2:1)

- 1) REPLACES PREMIER P/N B32-23001-17
- 2) MATERIAL: AISI 303 SS ROUND BAR, ANNEALED (REF DART SPEC. M303R)
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

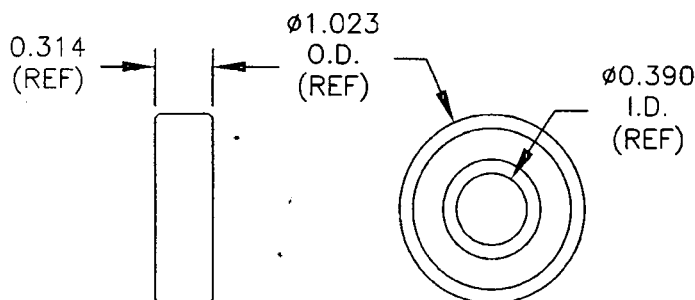


D3121-19 BEARING (SCALE 1:1)

- 1) POSSIBLE SUPPLIER: KING BEARING P/N 6000-2ZJ/EM FAFNIR P/N 9100KDD
- 2) ALL DIMENSIONS ARE IN INCHES

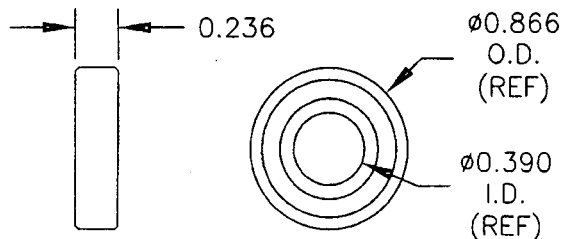


D3121-23 BEARING (SCALE 1:1)

- 1) POSSIBLE SUPPLIER: SKF P/N 61900-2Z OR KML P/N 6900-ZZ
- 2) ALL DIMENSIONS ARE IN INCHES

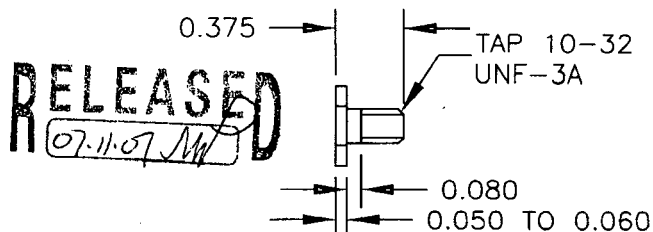


D3121-21 BOLT (SCALE 1:1)

- 1) MATERIAL: AISI 303 SS HEX, ANNEALED (REF DART SPEC. M303H0.500)
- 2) FINISH: NONE
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

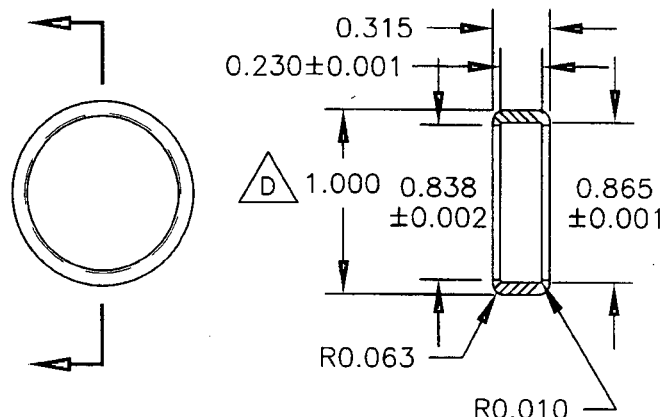

D3121-25 CAP (SCALE 1:1)

- 1) MATERIAL: DELRIN ROD, 1.25 (REF DART SPEC. M-DELRIN-R1.250)
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES

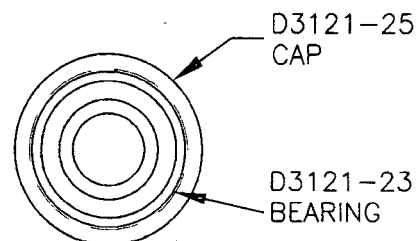

D3121-241 BEARING ASSEMBLY (SCALE 1:1)

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--